

# 10 6-1 (Bismuth 10 µg/mL in 2% HNO3)

### **High-Purity Standards**

Catalogue number: 10 6-1

Version No: 2.2 Safety Data Sheet according to OSHA HazCom Standard (2012) requirements

### SECTION 1 IDENTIFICATION

### **Product Identifier**

Product name	0 6-1 (Bismuth 10 μg/mL in 2% HNO3)				
Synonyms	Bismuth 10 µg/mL in 2% HNO3				
Proper shipping name	prrosive liquid, acidic, inorganic, n.o.s. (contains nitric acid)				
Other means of identification	10 6-1				

### Recommended use of the chemical and restrictions on use

Relevant identified uses Use according to manufacturer's directions.

### Name, address, and telephone number of the chemical manufacturer, importer, or other responsible party

Registered company name	High-Purity Standards
Address	PO Box 41727 SC 29423 United States
Telephone	843-767-7900
Fax	843-767-7906
Website	highpuritystandards.com
Email	Not Available

#### Emergency phone number

Association / Organisation	INFOTRAC
Emergency telephone numbers	1-800-535-5053
Other emergency telephone numbers	1-352-323-3500

### SECTION 2 HAZARD(S) IDENTIFICATION

Classification	Metal Corrosion Category 1, Skin Corrosion/Irritation Category 1A, Serious Eye Damage Category 1				
abel elements					
Hazard pictogram(s)					
SIGNAL WORD	DANGER				
lazard statement(s)					
H290	May be corrosive to metals.				
H314	Causes severe skin burns and eye damage.				

### Hazard(s) not otherwise specified

Not Applicable

Chemwatch Hazard Alert Code: 3

Issue Date: 05/30/2017

Print Date: 05/30/2017

S.GHS.USA.EN

Catalogue number: **10 6-1** Version No: **2.2** 

### 10 6-1 (Bismuth 10 µg/mL in 2% HNO3)

P260	Do not breathe dust/fume/gas/mist/vapours/spray.				
Precautionary statement(s	) Response				
P301+P330+P331 IF SWALLOWED: Rinse mouth. Do NOT induce vomiting.					
Precautionary statement(s	) Storage				
P405	Store locked up.				
Precautionary statement(s) Disposal					
P501	Dispose of contents/container in accordance with local regulations.				
	•				

### SECTION 3 COMPOSITION / INFORMATION ON INGREDIENTS

#### Substances

See section below for composition of Mixtures

### Mixtures

CAS No	%[weight]	Name
7697-37-2	2	nitric acid
7440-69-9	0.001	bismuth
7732-18-5	balance	water

### **SECTION 4 FIRST-AID MEASURES**

### Description of first aid measures

Eye Contact	If this product comes in contact with the eyes: <ul> <li>Immediately hold eyelids apart and flush the eye continuously with running water.</li> <li>Ensure complete irrigation of the eye by keeping eyelids apart and away from eye and moving the eyelids by occasionally lifting the upper and lower lids.</li> <li>Continue flushing until advised to stop by the Poisons Information Centre or a doctor, or for at least 15 minutes.</li> <li>Transport to hospital or doctor without delay.</li> <li>Removal of contact lenses after an eye injury should only be undertaken by skilled personnel.</li> </ul>
Skin Contact	<ul> <li>If skin or hair contact occurs:</li> <li>Immediately flush body and clothes with large amounts of water, using safety shower if available.</li> <li>Quickly remove all contaminated clothing, including footwear.</li> <li>Wash skin and hair with running water. Continue flushing with water until advised to stop by the Poisons Information Centre.</li> <li>Transport to hospital, or doctor.</li> </ul>
Inhalation	<ul> <li>If fumes or combustion products are inhaled remove from contaminated area.</li> <li>Lay patient down. Keep warm and rested.</li> <li>Prostheses such as false teeth, which may block airway, should be removed, where possible, prior to initiating first aid procedures.</li> <li>Apply artificial respiration if not breathing, preferably with a demand valve resuscitator, bag-valve mask device, or pocket mask as trained. Perform CPR if necessary.</li> <li>Transport to hospital, or doctor, without delay.</li> <li>Inhalation of vapours or aerosols (mists, fumes) may cause lung oedema.</li> <li>Corrosive substances may cause lung damage (e.g. lung oedema, fluid in the lungs).</li> <li>As this reaction may be delayed up to 24 hours after exposure, affected individuals need complete rest (preferably in semi-recumbent posture) and must be kept under medical observation, the administration of a spray containing a dexamethasone derivative or beclomethasone derivative may be considered.</li> <li>This must definitely be left to a doctor or person authorised by him/her.</li> <li>(ICSC13719)</li> </ul>
Ingestion	<ul> <li>For advice, contact a Poisons Information Centre or a doctor at once.</li> <li>Urgent hospital treatment is likely to be needed.</li> <li>If swallowed do NOT induce vomiting.</li> <li>If vomiting occurs, lean patient forward or place on left side (head-down position, if possible) to maintain open airway and prevent aspiration.</li> <li>Observe the patient carefully.</li> <li>Never give liquid to a person showing signs of being sleepy or with reduced awareness; i.e. becoming unconscious.</li> <li>Give water to rinse out mouth, then provide liquid slowly and as much as casualty can comfortably drink.</li> <li>Transport to hospital or doctor without delay.</li> </ul>

### Most important symptoms and effects, both acute and delayed

See Section 11

# Indication of any immediate medical attention and special treatment needed

For acute or short term repeated exposures to strong acids:

- Airway problems may arise from laryngeal edema and inhalation exposure. Treat with 100% oxygen initially.
- ▶ Respiratory distress may require cricothyroidotomy if endotracheal intubation is contraindicated by excessive swelling
- ▶ Intravenous lines should be established immediately in all cases where there is evidence of circulatory compromise.
- Strong acids produce a coagulation necrosis characterised by formation of a coagulum (eschar) as a result of the dessicating action of the acid on proteins in specific tissues.

INGESTION:

- Immediate dilution (milk or water) within 30 minutes post ingestion is recommended.
   DO NOT attempt to neutralise the acid since exothermic reaction may extend the corrosive injury.
- Be careful to avoid further vomit since re-exposure of the mucosa to the acid is harmful. Limit fluids to one or two glasses in an adult.
- Charcoal has no place in acid management.
- Some authors suggest the use of lavage within 1 hour of ingestion.

SKIN:

### 10 6-1 (Bismuth 10 µg/mL in 2% HNO3)

- Skin lesions require copious saline irrigation. Treat chemical burns as thermal burns with non-adherent gauze and wrapping.
- Deep second-degree burns may benefit from topical silver sulfadiazine.

EYE:

Version No: 2.2

- Eye injuries require retraction of the eyelids to ensure thorough irrigation of the conjuctival cul-de-sacs. Irrigation should last at least 20-30 minutes. DO NOT use neutralising agents or any other additives. Several litres of saline are required.
- Cycloplegic drops, (1% cyclopentolate for short-term use or 5% homatropine for longer term use) antibiotic drops, vasoconstrictive agents or artificial tears may be indicated dependent on the severity of the injury.
- Steroid eye drops should only be administered with the approval of a consulting ophthalmologist).

[Ellenhorn and Barceloux: Medical Toxicology]

### **SECTION 5 FIRE-FIGHTING MEASURES**

### Extinguishing media

- Water spray or fog.
- ► Foam.
- Dry chemical powder.
- BCF (where regulations permit).
- Carbon dioxide.

#### Special hazards arising from the substrate or mixture

Fire Incompatibility None known.

#### Special protective equipment and precautions for fire-fighters

Fire Fighting	<ul> <li>Alert Fire Brigade and tell them location and nature of hazard.</li> <li>Wear full body protective clothing with breathing apparatus.</li> <li>Prevent, by any means available, spillage from entering drains or water course.</li> <li>Use fire fighting procedures suitable for surrounding area.</li> <li>Do not approach containers suspected to be hot.</li> <li>Cool fire exposed containers with water spray from a protected location.</li> <li>If safe to do so, remove containers from path of fire.</li> <li>Equipment should be thoroughly decontaminated after use.</li> </ul>
Fire/Explosion Hazard	<ul> <li>Non combustible.</li> <li>Not considered to be a significant fire risk.</li> <li>Acids may react with metals to produce hydrogen, a highly flammable and explosive gas.</li> <li>Heating may cause expansion or decomposition leading to violent rupture of containers.</li> <li>May emit corrosive, poisonous fumes. May emit acrid smoke.</li> </ul>

### SECTION 6 ACCIDENTAL RELEASE MEASURES

#### Personal precautions, protective equipment and emergency procedures

See section 8

### **Environmental precautions**

See section 12

#### Methods and material for containment and cleaning up

Minor Spills	<ul> <li>Drains for storage or use areas should have retention basins for pH adjustments and dilution of spills before discharge or disposal of material.</li> <li>Check regularly for spills and leaks.</li> <li>Clean up all spills immediately.</li> <li>Avoid breathing vapours and contact with skin and eyes.</li> <li>Control personal contact with the substance, by using protective equipment.</li> <li>Contain and absorb spill with sand, earth, inert material or vermiculite.</li> <li>Wipe up.</li> <li>Place in a suitable, labelled container for waste disposal.</li> </ul>
Major Spills	<ul> <li>Clear area of personnel and move upwind.</li> <li>Alert Fire Brigade and tell them location and nature of hazard.</li> <li>Wear full body protective clothing with breathing apparatus.</li> <li>Prevent, by any means available, spillage from entering drains or water course.</li> <li>Consider evacuation (or protect in place).</li> <li>Stop leak if safe to do so.</li> <li>Contain spill with sand, earth or vermiculite.</li> <li>Collect recoverable product into labelled containers for recycling.</li> <li>Neutralise/decontaminate residue (see Section 13 for specific agent).</li> <li>Collect solid residues and see and prevent runoff into drains.</li> <li>After clean up operations, decontaminate and launder all protective clothing and equipment before storing and re-using.</li> <li>If contamination of drains or waterways occurs, advise emergency services.</li> </ul>

Personal Protective Equipment advice is contained in Section 8 of the SDS.

#### SECTION 7 HANDLING AND STORAGE

#### Precautions for safe handling

Safe handling	<ul> <li>Avoid all personal contact, including inhalation.</li> <li>Wear protective clothing when risk of exposure occurs.</li> <li>Use in a well-ventilated area.</li> </ul>
---------------	---

### Catalogue number: **10 6-1** Version No: **2.2**

# 10 6-1 (Bismuth 10 µg/mL in 2% HNO3)

<ul> <li>WARNING: To avoid violent reaction, ALWAYS add material to water and NEVER water to material.</li> <li>Avoid smoking, naked lights or ignition sources.</li> <li>Avoid contact with incompatible materials.</li> <li>When handling, DO NOT eat, drink or smoke.</li> <li>Keep containers securely sealed when not in use.</li> <li>Avoid physical damage to containers.</li> <li>Always wash hands with soap and water after handling.</li> <li>Work clothes should be laundered separately. Launder contaminated clothing before re-use.</li> <li>Use good occupational work practice.</li> <li>Observe manufacturer's storage and handling recommendations contained within this SDS.</li> <li>Atmosphere should be regularly checked against established exposure standards to ensure safe working conditions are maintained.</li> </ul>						
Other information	<ul> <li>Store in original containers.</li> <li>Keep containers securely sealed.</li> <li>Store in a cool, dry, well-ventilated area.</li> <li>Store away from incompatible materials and foodstuff containers.</li> <li>Protect containers against physical damage and check regularly for leaks.</li> <li>Observe manufacturer's storage and handling recommendations contained within this SDS.</li> </ul>					
nditions for safe storag	ge, including any incompatibilities					
Suitable container	<ul> <li>DO NOT use aluminium or galvanised containers</li> <li>Check regularly for spills and leaks</li> <li>Lined metal can, lined metal pail/ can.</li> <li>Plastic pail.</li> <li>Polyliner drum.</li> <li>Packing as recommended by manufacturer.</li> <li>Check all containers are clearly labelled and free from leaks.</li> <li>For low viscosity materials</li> <li>Drums and jerricans must be of the non-removable head type.</li> <li>Where a can is to be used as an inner package, the can must have a screwed enclosure.</li> <li>For materials with a viscosity of at least 2680 cSt. (23 deg. C) and solids (between 15 C deg. and 40 deg C.):</li> <li>Removable head packaging;</li> <li>Cans with friction closures and</li> <li>low pressure tubes and cartridges</li> <li>may be used.</li> <li>Where combination packages are used, and the inner packages are of glass, porcelain or stoneware, there must be sufficient inert cushioning material in contact with inner and outer packages unless the outer packaging is a close fitting moulded plastic box and the substances are not incompatible with the plastic.</li> </ul>					
Storage incompatibility	<ul> <li>Inorganic acids are generally soluble in water with the release of hydrogen ions. The resulting solutions have pH's of less than 7.0.</li> <li>Inorganic acids neutralise chemical bases (for example: amines and inorganic hydroxides) to form salts - neutralisation can generate dangerously large amounts of heat in small spaces.</li> <li>The dissolution of inorganic acids in water or the dilution of their concentrated solutions with additional water may generate significant heat.</li> <li>The dissolution of inorganic acids often generates sufficient heat in the small region of mixing to cause some of the water to boil explosively. The resulting "bumping" can spatter the acid.</li> <li>Inorganic acids react with active metals, including such structural metals as aluminum and iron, to release hydrogen, a flammable gas.</li> <li>Inorganic acids react with cyanide compounds to release gaseous hydrogen cyanide.</li> <li>Inorganic acids generate flammable and/or toxic gases in contact with dithiocarbarnates, isocyanates, mercaptans, nitrides, nitriles, sulfides, and strong reducing agents. Additional gas-generating reactions occur with sulfites, nitrites, thiosulfates (to give H2S and SO3), dithionites (SO2), and even carbonates.</li> <li>Acids often catalyse (increase the rate of) chemical reactions.</li> </ul>					

# SECTION 8 EXPOSURE CONTROLS / PERSONAL PROTECTION

### **Control parameters**

# OCCUPATIONAL EXPOSURE LIMITS (OEL)

### INGREDIENT DATA

Source	Ingredient	Material name	TWA	STEL	Peak	Notes
US OSHA Permissible Exposure Levels (PELs) - Table Z1	nitric acid	Nitric acid	5 mg/m3 / 2 ppm	10 mg/m3 / 4 ppm	Not Available	TLV® Basis: URT & eye irr; dental erosion
US NIOSH Recommended Exposure Limits (RELs)	nitric acid	Aqua fortis, Engravers acid, Hydrogen nitrate, Red fuming nitric acid (RFNA), White fuming nitric acid (WFNA)	5 mg/m3 / 2 ppm	4 ppm	Not Available	Not Available
US ACGIH Threshold Limit Values (TLV)	nitric acid	Nitric acid	2 ppm	Not Available	Not Available	Not Available

# EMERGENCY LIMITS

Ingredient	Material name	TEEL-1	TEEL-2	TEEL-3	
nitric acid	Nitric acid	Not Available	Not Available	Not Available	
bismuth	Bismuth	15 mg/m3	170 mg/m3	990 mg/m3	
Ingredient	Original IDLH 100 ppm		Revised IDLH		
nitric acid	100 ppm		25 ppm		
nitric acid bismuth	100 ppm Not Available		25 ppm Not Available		

Chemwatch: 9-241194 Catalogue number: 10 6-1 Version No: 2.2

### Issue Date: 05/30/2017 Print Date: 05/30/2017

# 10 6-1 (Bismuth 10 µg/mL in 2% HNO3)

	Engineering controls are used to remove a hazard or place a barrier between the worker and the hazard. Well-designed engineering controls can be highly			
	Engineering controls are used to remove a hazard or place a barrier between the worker and the ha effective in protecting workers and will typically be independent of worker interactions to provide this I The basic types of engineering controls are: Process controls which involve changing the way a job activity or process is done to reduce the risk. Enclosure and/or isolation of emission source which keeps a selected hazard "physically" away from "removes" air in the work environment. Ventilation can remove or dilute an air contaminant if designer the particular process and chemical or contaminant in use. Employers may need to use multiple types of controls to prevent employee overexposure.	high level of protection. the worker and ventilation that stra	tegically "adds" and	
	Local exhaust ventilation usually required. If risk of overexposure exists, wear approved respirator. C Supplied-air type respirator may be required in special circumstances. Correct fit is essential to ens An approved self contained breathing apparatus (SCBA) may be required in some situations. Provide adequate ventilation in warehouse or closed storage area. Air contaminants generated in the turn, determine the "capture velocities" of fresh circulating air required to effectively remove the cont	ure adequate protection. e workplace possess varying "esca		
	Type of Contaminant:		Air Speed:	
	solvent, vapours, degreasing etc., evaporating from tank (in still air).		0.25-0.5 m/s (50-100 f/min.)	
Appropriate engineering	aerosols, fumes from pouring operations, intermittent container filling, low speed conveyer transfer acid fumes, pickling (released at low velocity into zone of active generation)	rs, welding, spray drift, plating	0.5-1 m/s (100-200 f/min.)	
controls	direct spray, spray painting in shallow booths, drum filling, conveyer loading, crusher dusts, gas di zone of rapid air motion)	scharge (active generation into	1-2.5 m/s (200-500 f/min.)	
	grinding, abrasive blasting, tumbling, high speed wheel generated dusts (released at high initial ve air motion).	elocity into zone of very high rapid	2.5-10 m/s (500-2000 f/min.)	
	Within each range the appropriate value depends on:			
	Lower end of the range	Upper end of the range		
	1: Room air currents minimal or favourable to capture	1: Disturbing room air currents	its	
	2: Contaminants of low toxicity or of nuisance value only. 2: Contaminants of high toxic		ły	
	3: Intermittent, low production. 3: High production, heavy use			
	3: Intermittent, low production.	3: High production, heavy use		
	4: Large hood or large air mass in motion	4: Small hood-local control only	creases with the square	
		4: Small hood-local control only raction pipe. Velocity generally dec should be adjusted, accordingly, a a minimum of 1-2 m/s (200-400 f/n ons, producing performance defici	Ifter reference to nin) for extraction of ts within the extraction	
Personal protection	4: Large hood or large air mass in motion Simple theory shows that air velocity falls rapidly with distance away from the opening of a simple ext of distance from the extraction point (in simple cases). Therefore the air speed at the extraction point distance from the contaminating source. The air velocity at the extraction fan, for example, should be solvents generated in a tank 2 meters distant from the extraction point. Other mechanical considerati	4: Small hood-local control only raction pipe. Velocity generally dec should be adjusted, accordingly, a a minimum of 1-2 m/s (200-400 f/n ons, producing performance defici	Inter reference to Inin) for extraction of Its within the extraction	
Personal protection	<ul> <li>4: Large hood or large air mass in motion</li> <li>Simple theory shows that air velocity falls rapidly with distance away from the opening of a simple ext of distance from the extraction point (in simple cases). Therefore the air speed at the extraction point distance from the contaminating source. The air velocity at the extraction fan, for example, should be solvents generated in a tank 2 meters distant from the extraction point. Other mechanical considerati apparatus, make it essential that theoretical air velocities are multiplied by factors of 10 or more where apparatus, make it essential that theoretical air velocities are multiplied by factors of 10 or more where the extraction point (in simple cases).</li> <li>Safety glasses with unperforated side shields may be used where continuous eye protection is or where complete eye protection is needed such as when handling bulk-quantities, where there is pressure.</li> <li>Chemical goggles.whenever there is a danger of the material coming in contact with the eyes; a Full face shield (20 cm, 8 in minimum) may be required for supplementary but never for primary.</li> <li>Alternatively a gas mask may replace splash goggles and face shields.</li> <li>Contact lenses may pose a special hazard; soft contact lenses may absorb and concentrate infit lenses or restrictions on use, should be created for each workplace or task. This should include chemicals in use and an account of injury experience. Medical and first-aid personnel should be readily available. In the event of chemical exposure, begin eye irrigation immediately and remove at the first signs of eye redness or irritation - lens should be removed in a clean environment only</li> </ul>	4: Small hood-local control only raction pipe. Velocity generally dec should be adjusted, accordingly, a a minimum of 1-2 m/s (200-400 f/n ons, producing performance defici n extraction systems are installed of desirable, as in laboratories; specta a danger of splashing, or if the ma goggles must be properly fitted. protection of eyes; these afford fac ants. A written policy document, de a review of lens absorption and ac trained in their removal and suitab	Ifter reference to nin) for extraction of is within the extraction r used. Access are not sufficient terial may be under e protection. escribing the wearing of isorption for the class of le equipment should be e. Lens should be remove	
	<ul> <li>4: Large hood or large air mass in motion</li> <li>Simple theory shows that air velocity falls rapidly with distance away from the opening of a simple ext of distance from the extraction point (in simple cases). Therefore the air speed at the extraction point distance from the extraction point (in simple cases). Therefore the air speed at the extraction point distance from the contaminating source. The air velocity at the extraction point. Other mechanical considerati apparatus, make it essential that theoretical air velocities are multiplied by factors of 10 or more where of the complete event of the complete event of the shields may be used where continuous even protection is needed such as when handling bulk-quantities, where there is pressure.</li> <li>Chemical goggles.whenever there is a danger of the material coming in contact with the evers of Full face shield (20 cm, 8 in minimum) may be required for supplementary but never for primary</li> <li>Alternatively a gas mask may replace splash goggles and face shields.</li> <li>Contact lenses may pose a special hazard; soft contact lenses may about and concentrate irrit lenses or restrictions on use, should be created for each workplace or task. This should include chemicals in use and an account of injury experience. Medical and first-aid personnel should be readily available. In the event of chemical exposure, begin eye irrigation immediately and remover.</li> </ul>	4: Small hood-local control only raction pipe. Velocity generally dec should be adjusted, accordingly, a a minimum of 1-2 m/s (200-400 f/n ons, producing performance defici n extraction systems are installed of desirable, as in laboratories; specta a danger of splashing, or if the ma goggles must be properly fitted. protection of eyes; these afford fac ants. A written policy document, de a review of lens absorption and ac trained in their removal and suitab	Ifter reference to nin) for extraction of is within the extraction r used. Access are not sufficient terial may be under e protection. escribing the wearing of isorption for the class of le equipment should be e. Lens should be remove	
Eye and face protection	<ul> <li>4: Large hood or large air mass in motion</li> <li>Simple theory shows that air velocity falls rapidly with distance away from the opening of a simple ext of distance from the extraction point (in simple cases). Therefore the air speed at the extraction point distance from the extraction point (in simple cases). Therefore the air speed at the extraction point distance from the contaminating source. The air velocity at the extraction point. Other mechanical considerati apparatus, make it essential that theoretical air velocities are multiplied by factors of 10 or more where the extraction point (in simple cases). Therefore the air speed at the extraction point of the extraction point. Other mechanical considerati apparatus, make it essential that theoretical air velocities are multiplied by factors of 10 or more where the extraction point (in simple cases). Therefore the extraction point (in simple cases).</li> <li>Safety glasses with unperforated side shields may be used where continuous eye protection is of where complete eye protection is needed such as when handling bulk-quantities, where there is pressure.</li> <li>Chemical goggles whenever there is a danger of the material coming in contact with the eyes; a special face shield (20 cm, 8 in minimum) may be required for supplementary but never for primary.</li> <li>Alternatively a gas mask may replace splash goggles and face shields.</li> <li>Contact lenses may pose a special hazard; soft contact lenses may absorb and concentrate irrit lenses or restrictions on use, should be created for each workplace or task. This should be readily available. In the event of chemical exposure, begin eye irrigation immediately and remove at the first signs of eye redness or irritation - lens should be removed in a clean environment only Current Intelligence Bulletin 59], [AS/NZS 1336 or national equivalent]</li> </ul>	4: Small hood-local control only raction pipe. Velocity generally dec should be adjusted, accordingly, a a minimum of 1-2 m/s (200-400 fm ons, producing performance defici n extraction systems are installed of desirable, as in laboratories; specta a danger of splashing, or if the ma goggles must be properly fitted. protection of eyes; these afford fac ants. A written policy document, de a review of lens absorption and ac trained in their removal and suitab contact lens as soon as practicable a fler workers have washed hands	Ifter reference to in) for extraction of is within the extraction r used.	
Eye and face protection	<ul> <li>4: Large hood or large air mass in motion</li> <li>Simple theory shows that air velocity falls rapidly with distance away from the opening of a simple ext of distance from the extraction point (in simple cases). Therefore the air speed at the extraction point distance from the contaminating source. The air velocity at the extraction fan, for example, should be solvents generated in a tank 2 meters distant from the extraction point. Other mechanical considerati apparatus, make it essential that theoretical air velocities are multiplied by factors of 10 or more where</li> <li>Safety glasses with unperforated side shields may be used where continuous eye protection is of where complete eye protection is needed such as when handling bulk-quantities, where there is pressure.</li> <li>Chemical goggles whenever there is a danger of the material coming in contact with the eyes; of Full face shield (20 cm, 8 in minimum) may be required for supplementary but never for primary</li> <li>Alternatively a gas mask may replace splash goggles and face shields.</li> <li>Contact lenses may pose a special hazard; soft contact lenses may absorb and concentrate irrit lenses or restrictions on use, should be created for each workplace or task. This should include chemicals in use and an account of injury experience. Medical and first-aid personnel should be readily available. In the event of chemical exposure, begin eye irrigation immediately and remove at the first signs of eye redness or irritation - lens should be removed in a clean environment only Current Intelligence Bulletin 59], [AS/NZS 1336 or national equivalent]</li> <li>See Hand protection below</li> <li>Elbow length PVC gloves</li> </ul>	4: Small hood-local control only raction pipe. Velocity generally dec should be adjusted, accordingly, a a minimum of 1-2 m/s (200-400 fm ons, producing performance defici n extraction systems are installed of desirable, as in laboratories; specta a danger of splashing, or if the ma goggles must be properly fitted. protection of eyes; these afford fac ants. A written policy document, de a review of lens absorption and ac trained in their removal and suitab contact lens as soon as practicable a fler workers have washed hands	Ifter reference to nin) for extraction of is within the extraction r used. Access are not sufficient terial may be under e protection. escribing the wearing of isorption for the class of le equipment should be e. Lens should be remove	
Eye and face protection Skin protection Hands/feet protection	<ul> <li>4: Large hood or large air mass in motion</li> <li>Simple theory shows that air velocity falls rapidly with distance away from the opening of a simple ext of distance from the extraction point (in simple cases). Therefore the air speed at the extraction point distance from the contaminating source. The air velocity at the extraction point. Other mechanical considerati apparatus, make it essential that theoretical air velocities are multiplied by factors of 10 or more where apparatus, make it essential that theoretical air velocities are multiplied by factors of 10 or more where of where complete eye protection is needed such as when handling bulk-quantities, where there is pressure.</li> <li>Safety glasses with unperforated side shields may be used where continuous eye protection is o where complete eye protection is needed such as when handling bulk-quantities, where there is pressure.</li> <li>Chemical goggles.whenever there is a danger of the material coming in contact with the eyes; of Full face shield (20 cm, 8 in minimum) may be required for supplementary but never for primary Alternatively a gas mask may replace splash goggles and face shields.</li> <li>Contact lenses may pose a special hazard; soft contact lenses may absorb and concentrate infit lenses or restrictions on use, should be created for each workplace or task. This should include chemicals in use and an account of injury experience. Medical and first-aid personnel should be readily available. In the event of chemical exposure, begin eye irrigation immediately and remove at the first signs of eye redness or irritation - lens should be removed in a clean environment only Current Intelligence Bulletin 59], [AS/NZS 1336 or national equivalent]</li> <li>See Hand protection below</li> <li>Elbow length PVC gloves</li> <li>When handling corrosive liquids, wear trousers or overalls outside of boots, to avoid spills enter output and the spills enter</li> </ul>	4: Small hood-local control only raction pipe. Velocity generally dec should be adjusted, accordingly, a a minimum of 1-2 m/s (200-400 fm ons, producing performance defici n extraction systems are installed of desirable, as in laboratories; specta a danger of splashing, or if the ma goggles must be properly fitted. protection of eyes; these afford fac ants. A written policy document, de a review of lens absorption and ac trained in their removal and suitab contact lens as soon as practicable a fler workers have washed hands	Ifter reference to in) for extraction of is within the extraction r used.	

# **Respiratory protection**

Type A Filter of sufficient capacity. (AS/NZS 1716 & 1715, EN 143:2000 & 149:2001, ANSI Z88 or national equivalent)

# SECTION 9 PHYSICAL AND CHEMICAL PROPERTIES

### Information on basic physical and chemical properties

Appearance	colorless		
Physical state	Liquid	Relative density (Water = 1)	Not Available

Catalogue number: **10 6-1** Version No: **2.2** 

# 10 6-1 (Bismuth 10 $\mu\text{g/mL}$ in 2% HNO3)

Odour	Not Available	Partition coefficient n-octanol / water	Not Available
Odour threshold	Not Available	Auto-ignition temperature (°C)	Not Available
pH (as supplied)	<2	Decomposition temperature	Not Available
Melting point / freezing point (°C)	Not Available	Viscosity (cSt)	Not Available
Initial boiling point and boiling range (°C)	Not Available	Molecular weight (g/mol)	Not Available
Flash point (°C)	Not Available	Taste	Not Available
Evaporation rate	Not Available	Explosive properties	Not Available
Flammability	Not Available	Oxidising properties	Not Available
Upper Explosive Limit (%)	Not Available	Surface Tension (dyn/cm or mN/m)	Not Available
Lower Explosive Limit (%)	Not Available	Volatile Component (%vol)	Not Available
Vapour pressure (kPa)	Not Available	Gas group	Not Available
Solubility in water (g/L)	Miscible	pH as a solution (1%)	Not Available
Vapour density (Air = 1)	Not Available	VOC g/L	Not Available

# SECTION 10 STABILITY AND REACTIVITY

Reactivity	See section 7
Chemical stability	<ul> <li>Contact with alkaline material liberates heat</li> <li>Unstable in the presence of incompatible materials.</li> <li>Product is considered stable.</li> <li>Hazardous polymerisation will not occur.</li> </ul>
Possibility of hazardous reactions	See section 7
Conditions to avoid	See section 7
Incompatible materials	See section 7
Hazardous decomposition products	See section 5

# SECTION 11 TOXICOLOGICAL INFORMATION

### Information on toxicological effects

Inhaled	The material can cause respiratory irritation in some persons. The body's response to such irritation can cause further lung damage. Corrosive acids can cause irritation of the respiratory tract, with coughing, choking and mucous membrane damage. There may be dizziness, headache, nausea and weakness. The material has <b>NOT</b> been classified by EC Directives or other classification systems as "harmful by inhalation". This is because of the lack of corroborating animal or human evidence.				
Ingestion	Ingestion of acidic corrosives may produce burns around and in the mouth, the throat and oesophagus. Immediate pain and difficulties in swallowing and speaking may also be evident. The material has <b>NOT</b> been classified by EC Directives or other classification systems as "harmful by ingestion". This is because of the lack of corroborating animal or human evidence.				
Skin Contact	Skin contact with acidic corrosives may result in pain and burns; these may be deep with distinct edges and may heal slowly with the formation of scar tissue. Skin contact is not thought to have harmful health effects (as classified under EC Directives); the material may still produce health damage following entry through wounds, lesions or abrasions. Open cuts, abraded or irritated skin should not be exposed to this material Entry into the blood-stream, through, for example, cuts, abrasions or lesions, may produce systemic injury with harmful effects. Examine the skin prior to the use of the material and ensure that any external damage is suitably protected.				
Eye	If applied to the eyes, this material causes severe eye damage. Direct eye contact with acid corrosives may produce pain, tears, sensitivity to light and burns. Mild burns of the epithelia generally recover rapidly and completely.				
Chronic	Repeated or prolonged exposure to acids may result in the erosion of teeth, swelling and/or ulceration of mouth lining. Irritation of airways to lung, with cough, and inflammation of lung tissue often occurs. Long-term exposure to respiratory irritants may result in airways disease, involving difficulty breathing and related whole-body problems. Substance accumulation, in the human body, may occur and may cause some concern following repeated or long-term occupational exposure.				
10 6-1 (Bismuth 10 µg/mL in	TOXICITY	IRRITATION			
2% HNO3)	Not Available Not Available				
nitric acid	ΤΟΧΙΟΙΤΥ			RRITATION	
	Inhalation (rat) LC50: 625 ppm/1h*t <sup>[2]</sup> Not Available		Not Available		
bismuth	TOXICITY	1	IRRIT/	ATION	
Jonuti	Oral (rat) LD50: 2000 mg/kg <sup>[1]</sup>	1	Not Av	vailable	

Chemwatch: 9-241194 Catalogue number: 10 6-1

Version No: 2.2

Page 7 of 10

10 6-1 (Bismuth 10 µg/mL in 2% HNO3)

Legend: 1. Value obtained from Europe ECHA Registered Substances - Acute toxicity 2.* Value obtained from manufacturer's SDS. Unless otherwise species extracted from RTECS - Register of Toxic Effect of chemical Substances			rom manufacturer's SDS. Unless otherwise specified data
NITRIC ACID	Asthma-like symptoms may continue for months or even years after ex For acid mists, aerosols, vapours Test results suggest that eukaryotic cells are susceptible to genetic da The material may produce severe irritation to the eye causing pronour The material may produce respiratory tract irritation, and result in dar The material may cause severe skin irritation after prolonged or repea vesicles, scaling and thickening of the skin. Oral (?) LD50: 50-500 mg/kg * [Various Manufacturers]	amage when the pH falls to a nced inflammation. mage to the lung including re	educed lung function.
WATER	No significant acute toxicological data identified in literature search.		
Acute Toxicity	0	Carcinogenicity	$\odot$
Acute Toxicity Skin Irritation/Corrosion	<ul> <li>○</li> <li>✓</li> </ul>	Carcinogenicity Reproductivity	0
	<ul> <li>✓</li> <li>✓</li> <li>✓</li> </ul>		
Skin Irritation/Corrosion Serious Eye	✓ s	Reproductivity	0

Data available to make classification

🚫 – Data Not Available to make classification

# SECTION 12 ECOLOGICAL INFORMATION

10 6-1 (Bismuth 10 μg/mL in 2% HNO3)	ENDPOINT	TEST DURATION (HR)			VALUE		SOURCE
	Not Applicable	Not Applicable			Not Appli	icable	Not Applicable
	ENDPOINT	TEST DURATION (HR)		SPECIES	,	VALUE	SOURCE
nitric acid	NOEC	16 Crustacea 107mg		107mg/L	4		
	ENDPOINT	TEST DURATION (HR)	SPECIES	6	VALUE		SOURCE
bismuth	Not Applicable	Not Applicable	Not Appl	cable	Not Appli	icable	Not Applicable
	ENDPOINT	TEST DURATION (HR)	SPECIES	6	VALUE		SOURCE
water	Not Applicable	Not Applicable	Not Appl	cable	Not Appli	icable	Not Applicable

Ecotoxicity:

The tolerance of water organisms towards pH margin and variation is diverse. Recommended pH values for test species listed in OECD guidelines are between 6.0 and almost 9. Acute testing with fish showed 96h-LC50 at about pH 3.5 Prevent, by any means available, spillage from entering drains or water courses.

(Japan) - Bioconcentration Data 7. METI (Japan) - Bioconcentration Data 8. Vendor Data

DO NOT discharge into sewer or waterways

### Persistence and degradability

Ingredient	Persistence: Water/Soil	Persistence: Air
water	LOW	LOW

### **Bioaccumulative potential**

Ingredient	Bioaccumulation
water	LOW (LogKOW = -1.38)

### Mobility in soil

Ingredient	Mobility
water	LOW (KOC = 14.3)


### SECTION 13 DISPOSAL CONSIDERATIONS

Chemwatch: 9-241194 Catalogue number: 10 6-1 Page 8 of 10 10 6-1 (Bismuth 10 µg/mL in 2% HNO3)

Version No: 2.2		
	Product / Packaging disposal	<ul> <li>Recycle wherever possible.</li> <li>Consult manufacturer for recycling options or consult local or regional waste management authority for disposal if no suitable treatment or disposal facility can be identified.</li> <li>Treat and neutralise at an approved treatment plant. Treatment should involve: Neutralisation with soda-ash or soda-lime followed by: burial in a land-fill specifically licensed to accept chemical and / or pharmaceutical wastes or Incineration in a licensed apparatus (after admixture with suitable combustible material).</li> <li>Decontaminate empty containers with 5% aqueous sodium hydroxide or soda ash, followed by water. Observe all label safeguards until containers are</li> </ul>
		cleaned and destroyed.

# SECTION 14 TRANSPORT INFORMATION

# Labels Required

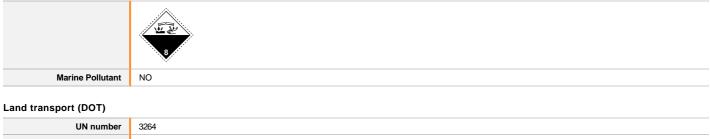

UN proper shipping name	Corrosive liquid, acidic, inorganic, n.o.s. (contains nitric acid)
Transport hazard class(es)	Class8SubriskNot Applicable
Packing group	11
Environmental hazard	Not Applicable
Special precautions for user	Hazard Label8Special provisions386, B2, IB2, T11, TP2, TP27

# Air transport (ICAO-IATA / DGR)

UN number	3264	
UN proper shipping name	CORROSIVE LIQUID, ACIDIC, INORGANIC, N.O.S. (contai	ns nitric acid)
Transport hazard class(es)	ICAO/IATA Class8ICAO / IATA SubriskNot ApplicableERG Code8L	
Packing group	Ш	
Environmental hazard	Not Applicable	
Special precautions for user	Special provisions         Cargo Only Packing Instructions         Cargo Only Maximum Qty / Pack         Passenger and Cargo Packing Instructions         Passenger and Cargo Maximum Qty / Pack         Passenger and Cargo Limited Quantity Packing Instructions         Passenger and Cargo Limited Maximum Qty / Pack	A3A803 855 30 L 851 1 L Y840 0.5 L

# Sea transport (IMDG-Code / GGVSee)

UN number	3264
UN proper shipping name	Corrosive liquid, acidic, inorganic, n.o.s. * (contains nitric acid)
Transport hazard class(es)	IMDG Class8IMDG SubriskNot Applicable
Packing group	ll
Environmental hazard	Not Applicable
Special precautions for user	EMS NumberF-A, S-BSpecial provisions274Limited Quantities1 L

Version No: 2.2

# 10 6-1 (Bismuth 10 µg/mL in 2% HNO3)

### Transport in bulk according to Annex II of MARPOL and the IBC code

Source	Product name	Pollution Category	Ship Type
IMO MARPOL (Annex II) - List of Noxious Liquid Substances Carried in Bulk	Nitric acid (70% and over) Nitric acid (less than 70%)	Y; Y	2 2

### **SECTION 15 REGULATORY INFORMATION**

### Safety, health and environmental regulations / legislation specific for the substance or mixture

nternational Air Transport Association (IATA) Dangerous Goods Regulations - Prohibited List	US - Vermont Permissible Exposure Limits Table Z-1-A Final Rule Limits for Air Contaminants
Passenger and Cargo Aircraft	US - Vermont Permissible Exposure Limits Table Z-1-A Transitional Limits for Air
US - Alaska Limits for Air Contaminants	Contaminants
US - California OEHHA/ARB - Acute Reference Exposure Levels and Target Organs (RELs)	US - Washington Permissible exposure limits of air contaminants
US - California Permissible Exposure Limits for Chemical Contaminants	US - Washington Toxic air pollutants and their ASIL, SQER and de minimis emission values
US - Hawaii Air Contaminant Limits	US - Wyoming Toxic and Hazardous Substances Table Z1 Limits for Air Contaminants
US - Idaho - Limits for Air Contaminants	US ACGIH Threshold Limit Values (TLV)
US - Massachusetts - Right To Know Listed Chemicals	US CWA (Clean Water Act) - List of Hazardous Substances
US - Michigan Exposure Limits for Air Contaminants	US EPCRA Section 313 Chemical List
US - Minnesota Permissible Exposure Limits (PELs)	US NIOSH Recommended Exposure Limits (RELs)
JS - Oregon Permissible Exposure Limits (Z-1)	US OSHA Permissible Exposure Levels (PELs) - Table Z1
US - Pennsylvania - Hazardous Substance List	US SARA Section 302 Extremely Hazardous Substances
US - Rhode Island Hazardous Substance List	US Toxic Substances Control Act (TSCA) - Chemical Substance Inventory
US - Tennessee Occupational Exposure Limits - Limits For Air Contaminants	
BISMUTH(7440-69-9) IS FOUND ON THE FOLLOWING REGULATORY LISTS	
US Toxic Substances Control Act (TSCA) - Chemical Substance Inventory	
WATER(7732-18-5) IS FOUND ON THE FOLLOWING REGULATORY LISTS	
US - Pennsylvania - Hazardous Substance List	US Toxic Substances Control Act (TSCA) - Chemical Substance Inventory

### **Federal Regulations**

### Superfund Amendments and Reauthorization Act of 1986 (SARA)

### SECTION 311/312 HAZARD CATEGORIES

Immediate (acute) health hazard	Yes
Delayed (chronic) health hazard	No
Fire hazard	No
Pressure hazard	No
Reactivity hazard	No

### US. EPA CERCLA HAZARDOUS SUBSTANCES AND REPORTABLE QUANTITIES (40 CFR 302.4)

Name	Reportable Quantity in Pounds (Ib)	Reportable Quantity in kg
Nitric acid	1000	454

### State Regulations

### US. CALIFORNIA PROPOSITION 65

None Reported

National Inventory	Status
Australia - AICS	Υ
Canada - DSL	Y
Canada - NDSL	N (bismuth; water; nitric acid)
China - IECSC	Υ
Europe - EINEC / ELINCS / NLP	Υ
Japan - ENCS	N (bismuth; water; nitric acid)
Korea - KECI	Υ
New Zealand - NZIoC	Y
Philippines - PICCS	Υ
USA - TSCA	Υ
Legend:	Y = All ingredients are on the inventory N = Not determined or one or more ingredients are not on the inventory and are not exempt from listing(see specific ingredients in brackets)

# **SECTION 16 OTHER INFORMATION**

### Other information

Classification of the preparation and its individual components has drawn on official and authoritative sources as well as independent review by the Chemwatch Classification committee using

### Page 10 of 10

# 10 6-1 (Bismuth 10 µg/mL in 2% HNO3)

Version No: 2.2

#### available literature references.

The SDS is a Hazard Communication tool and should be used to assist in the Risk Assessment. Many factors determine whether the reported Hazards are Risks in the workplace or other settings. Risks may be determined by reference to Exposures Scenarios. Scale of use, frequency of use and current or available engineering controls must be considered.

#### **Definitions and abbreviations**

PC – TWA: Permissible Concentration-Time Weighted Average PC – STEL: Permissible Concentration-Short Term Exposure Limit IARC: International Agency for Research on Cancer ACGIH: American Conference of Governmental Industrial Hygienists STEL: Short Term Exposure Limit TEEL: Temporary Emergency Exposure Limit<sub>o</sub> IDLH: Immediately Dangerous to Life or Health Concentrations OSF: Odour Safety Factor NOAEL: No Observed Adverse Effect Level LOAEL: Lowest Observed Adverse Effect Level LOAEL: Lowest Observed Adverse Effect Level LOD: Limit of Detection OTV: Odour Threshold Value BCF: BioConcentration Factors BEI: Biological Exposure Index

#### This document is copyright.

Apart from any fair dealing for the purposes of private study, research, review or criticism, as permitted under the Copyright Act, no part may be reproduced by any process without written permission from CHEMWATCH. TEL (+61 3) 9572 4700.

